
Smoke and Dye Testing Summary

High Level Sewershed

Run Summary ————————————————————————————————————							
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-235	Smoke	8/12/2009	ADS/TM	S2100_009MH	Dry	Yes	832.81

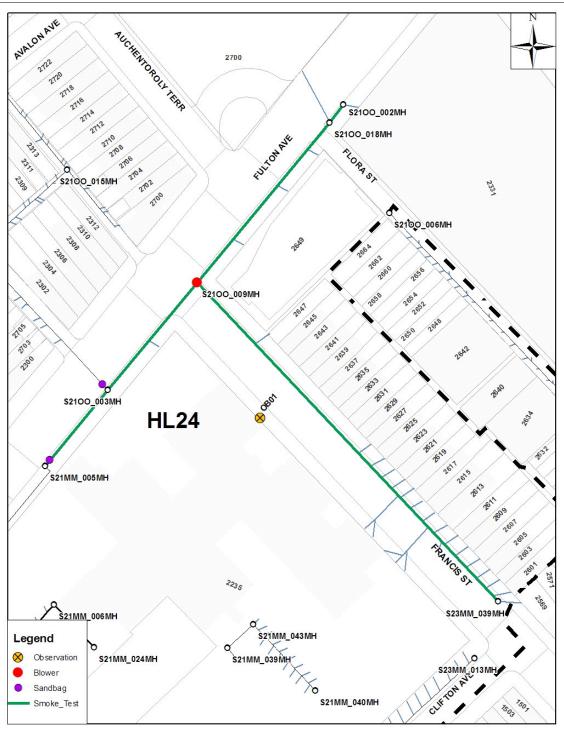

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary —							
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-235	Smoke	8/12/2009	ADS/TM	S2100_009MH	Dry	Yes	832.81

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S2100_018G1	S2100_018MH	S21OO_009MH	190.847	8
S21OO_002G1	S21OO_002MH	S21OO_018MH	20.7527	8
S21OO_003G1	S21OO_003MH	S21MM_005MH	90.322	10
S23MM_039G1	S23MM_039MH	S21OO_009MH	402.51	8
S21OO_009G1	S21OO_009MH	S21OO_003MH	128.381	8

Observations & Photos

Obs_ID S1028-235-OB01 **Address** 2235 Francis St

StatusPrivateSourceCleanoutLocationSidewalkNearest MHS2100_009MH

Comments Smoke from above-grade cleanout in sidewalk

near building entrance. 2235 Francis St.



Picture \S1028-235-OB01-P01.jpg

Comments Front of building, 2235 Francis St.